

**Minutes of Weekly Performance Review Video Conference(Webex) held on
04.11.2020.**

Present:

1. Shri G.K. Dwivedy, PCSTE
2. Shri J.P. Shivaji, CCE
3. Shri S. Mukherjee, CSE
4. Shri Hemant Kumar, Dy. CSTE/HQ
5. Shri A. Paldeeya, Sr. DSTE/ASN
6. Shri V. Kumar, Sr. DSTE/HWH
7. Shri S. P. Yadav, Sr. DSTE/MLDT
8. Shri M.M. Srivastava, Sr. DSTE/SDAH

During the weekly performance review conference on 04.11.2020, the following points were discussed.


Sl. No.	Description	Action to be taken by/TDC
1.0	Review of actionable items of previous minutes of VC:-	All Sr. DSTEs
1.1	Disconnection memos in all the division in the previous week were lower than the bench mark figures. Sr.DSTEs mentioned that due to leave/holidays maintenance schedule has been affected slightly. Maintenance through disconnection memos should be pulled up post festivals.	
1.2	Defective joints and bad patches in 06/04 Quad cables : -All Sr. DSTEs Sr.DSTE/HWH & SDAH have submitted revised cable repair plan. Sr.DSTE/MLDT mentioned that one section at Bakudih has been completed. Sr. DSTE/ASN informed that 20 bad joints in 02 block sections have been replaced. Progress of 06/04 Quad Cable repairing work should be updated monthly to HQ.	
1.2.1	Sr.DSTE/MLDT informed that RE organization is yet to submit TDC for 07 Block sections. Any new work of RE should be started only after firm commitment of attending of cables in above section. PCSTE instructed Sr.DSTE/MLDT to jointly finalize the works to be done along with TDC with RE to expedite the work.	Sr.DSTE/MLDT
1.2.2	Sr. DSTE/SDAH informed that 08 bad joints have been rectified so far.	Sr. DSTE/SDAH
1.2.3	Sr. DSTE/HWH informed that 36 block section identified. Quad cable has been laid in about 04 KM in Khana – Jhapter Dhal section.	Sr.DSTE/HWH

1.3	After review of requirements, only 31 stations are feasible where TIB can be connected with NTES. Division-wise breakup and progress are as follows.				
	Division	TIB Feasible for commissioning	Done	TDC for remaining	CCE, Sr.DSTE/HWH & SDAH,
	HWH	12	4	30.11.2020	
	SDAH	11	7	12.11.2020	
	ASN	1	1	completed	
	MLDT	7	7	completed	
1.4	Water logging issues:- All divisions confirmed that joint inspection of ADEN and ADSTE have started. Concrete action plan by Sr.DEN & Sr.DSTE should be submitted to HQ by 30.11.2020.				All Sr. DSTEs
1.5	Sr. DSTE level inspection of bad performing Titagarh station: - Action taken report to be submitted to HQ by 15.11.2020.				Sr. DSTE/ SDAH
1.6	Database for G.G.Trionics Axle counter failures for last one year: (Ref: Item No. 1.7 of previous MOM). Sr. DSTE/MLDT, Sr. DSTE/ASN, Sr. DSTE/SDAH & Sr. DSTE/HWH informed that database is being made for the period of April 2020 to October 2020. Letter to OEM and RDSO based on data base should be sent by 15.11.2020.				All Sr. DSTEs, CSE
1.7	Kalyanchak-KXE/MLDT Divn: Sr. DSTE/MLDT informed that tail cable meggering done for 20 TC out of 39 TC and it will be completed by 15.11.2020.				Sr. DSTE/MLDT
1.8	Ballygunge/SDAH DIVN :- TC-34T failed on DN Line on 22/10/2020. During discussion, Sr. DSTE/SDAH informed that in BLN/RRI, total number of track circuit is 129. Till date 60% of the defective cables have been replaced. Sr.DSTE/SDAH mentioned that the balance work can be completed by 10 km of 6 core cable. Sr.DSTE/SDAH further informed that he has not received 6 core, 2 core cables from Stores Deptt. in the last 3 financial ear. Dy.CSTE/HQ may reconcile pending cable indent position vis-à-vis AAC of all divisions and share by 10.11.2020.				All Sr. DSTEs, Dy.CSTE/HQ
1.9	Kunuri/ASN DIVN:- Point-52 normal lock slide broken on 21/10/2020. Sr. DSTE/ASN informed that letter given to RDSO and lock slide was sent at Liluah workshop. Findings shall be shared with HQ for further action.				Sr. DSTE/ASN
2.0	Narganjo – Jhaja/ASN DIVN:- BPAC failed on 21/10/2020. Installation of IPS at Narganjo: TDC 20.12.2020.				Sr. DSTE/ASN

2.1	<p>Bakudi/MLDT DIVN:-DC-DC converter got defective on 23/10/2020. (Ref: Item No. 5.2 of previous MOM)</p> <p>1) Sr.DSTE/MLDT informed that undersize cable have been replaced with 16 mm² copper cable and voltage drop now between Power Rack & IPS is 01 Volt.</p>	Sr. DSTE/MLDT																		
	Review of failures during the period (26.10.2020 to 01.11.2020):-																			
3.0	<p>Out of total 124 failures during the period, 14 were discussed due to their seriousness and systemic in nature. Division-wise breakup is as following: -</p> <table border="1"> <thead> <tr> <th>DIVISION</th><th>TOTAL FAILURES (From 26th Oct - 01st Nov. 2020)</th><th>Discussed failures</th></tr> </thead> <tbody> <tr> <td>HWH</td><td>30</td><td>03</td></tr> <tr> <td>SDAH</td><td>24</td><td>04</td></tr> <tr> <td>ASN</td><td>24</td><td>03</td></tr> <tr> <td>MLDT</td><td>46</td><td>04</td></tr> <tr> <td>Total</td><td>124</td><td>14</td></tr> </tbody> </table>	DIVISION	TOTAL FAILURES (From 26 th Oct - 01 st Nov. 2020)	Discussed failures	HWH	30	03	SDAH	24	04	ASN	24	03	MLDT	46	04	Total	124	14	All Sr. DSTEs
DIVISION	TOTAL FAILURES (From 26 th Oct - 01 st Nov. 2020)	Discussed failures																		
HWH	30	03																		
SDAH	24	04																		
ASN	24	03																		
MLDT	46	04																		
Total	124	14																		
3.1	<p>Gangpur/HWH DIVN:-20K Micro Farad condenser of WJR defective on 01/11/2020.</p> <p>CSE instructed to replace electrolytic condenser periodically every 05 years.</p>	All Sr. DSTEs																		
3.2	<p>Kanchrapara/SDAH DIVN:- CRU defective for HG aspect on 31/10/2020. It is surprising that main line signals are still provided with non-integrated LED aspects.</p> <p>PCSTE instructed that all signals on Main Line should be replaced with integrated LED received from Stores. TDC 30.06.2021.</p>	All Sr. DSTE																		
3.3	<p>Between Gobardanga-Machlandapur/SDAH DIV: - UP & DN BPAC failed on 30/10/2020. During discussion, Sr. DSTE/SDAH informed that both OFC and 6 Quad Cable have been damaged in the section. The damage location is inundated in water.</p> <p>ADSTE should be sent to the site to find a solution for repairing the cables at the earliest.</p>	Sr. DSTE/SDAH																		
3.4	<p>Nathnagar/MLDT DIVN :-IPS Battery +ve pole broken from base on 30/10/2020.Sr.DSTE/MLDT has written a letter to OEM (LABCO) & RDSO. It's outline should be followed and report with OEM is to be shared for corrective actions.</p>	Sr. DSTE/MLDT																		

3.5	Between Rupnarayanpur - Bariarpur/MLDT DIVN:-UP BPAC failed on 01/11/2020. CSE instructed technical audit to be done at the level of DSTE/ADSTE & report with earthing parameters to be sent to CSE by 15/11/2020.	Sr. DSTE/MLDT
3.6	Between Murahara - Baka/MLDT DIVN:- BPAC failed on 29/10/2020. CSE instructed technical audit to be done at the level of DSTE/ADSTE & report with earthing parameters to be sent to CSE by 15/11/2020.	Sr. DSTE/MLDT
3.7	CCE instructed that action plan on the Telecom PRIME items by divisions should be submitted in time by 10.11.2020.	All Sr. DSTEs
	Assistance sought from Divisions: 1. Sr.DSTE/HWH requested for early finalization of SIP of LC no.44.	Dy.CSTE/W/D&D

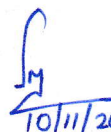


10/11/2020
(S. Mukherjee)
CSE/ER

No. SG158/2

Kolkata, dt.10.11.2020

Copy for information and necessary action to: -

1. CSTE/Plg., CSTE/CON., CSTE/Proj, CCE
2. Sr. DSTE/ASN, HWH, MLDT & SDAH, Dy.CSTE/W/D&D